

<b>VEHICLE INSPECTION REPORT - AUTOMOBILE</b>	
<b>VIN:</b>	JNRBS08W53X402040
<b>Year:</b>	2003
<b>Make:</b>	Infiniti
<b>Model:</b>	FX45
<b>Odometer (m/km.):</b>	19394
<b>Exterior Color:</b>	Silver
<b>Interior Color:</b>	Black
<b>Assgn. Date:</b>	03/07/2006
<b>Insp. Date:</b>	03/09/2006
<b>Body Type/Doors:</b>	Sport Utility
<b>Engine (Fuel) Type:</b>	Gasoline
<b>Turbo/Supercharged:</b>	No
<b>Eng. Cyl. /Arrange:</b>	8 Cylinder
<b>Engine:</b>	4.5
<b>Drive/Gears/Trans.:</b>	Automatic

<b>ACCESSORIES:</b>		
Air Cond, Front	Seats, Bucket	Glass, Tinted
Antenna	Seats, Pass.Heated	Key, Remote Entry
Audio, CD Changer-6	Speakers, Rear	Mirror, Vanity - Driver
Climate Control, Auto	Sunshade, Windshield	Rack, Luggage
Door, Power Locks	Visor, Auxiliary - Passenger	Seat, Power Pass.
Headrest, Driver	Airbag, Dual	Seats, Dual Heated
Lights, Fog	Armrest/Console, Front Center	Shifter, Floor
Mirrors, Power Side	Brakes, 4 Whl Disc	Steering Wheel, Tilt
Seat, Driver Memory	Cup Holder(s), Front	Transmission, Auto 4-Speed
Seating, 5-Pass.	Floor Mats	Windows, Power
Seats, Leather	Headrest, Rear	Airbag, Side
Speakers, Front & Rear 6	Mirror, Lighted Vanity	Audio, AM/FM/Cassette/CD
Sunroof, Power	Navigation System, CDROM	Cargo Mat/Tray
Visor, Auxiliary - Driver	Seat, Power Driver	Door Bin, Passenger
Airbag, Driver	Seats, Driver Heated	Grille, Chrome
Armrest, Rear Seat Center	Security Alarm, OEM	Keys, Infrared
Audio, Premium Sound Sys.	Steering Wheel, Telescopic	Mirror, Vanity - Passenger
Climate Control, Dual Zone	Tachometer	Rear Defroster
Drive, All Wheel	Wheels, Alloy	Seatback Storage Pockets
Headrest, Passenger	Airbag, Passenger	Seats, Dual Power
Mirror, Auto-dim Rearview	Audio Control, Steering Whl	Speakers, Front
Navigation System	Bumper, Rear	Steering, Power
Seat, Lumbar Support	Door Bin, Driver	Video, DVD

<b>TIRES:</b>											
Pos.	Tread	Manufacturer	Diameter	Actual Size		Pos.	Tread	Manufacturer	Diameter		Actual Size
LF	5/32"	Goodyear	20"	265.50R20		RF	5/32"	Goodyear	20"		265.50R15
LR	5/32"	Goodyear	20"	265.50R20		RR	5/32"	Goodyear	20"		265.50R20
SP	4/32"	Goodyear	18"	175.90D18		Other					

EXCEPTION/DAMAGE: AN EXCEPTION IS A CONDITION NOTED OUT OF THE ORDINARY

<b>Zone/Area/Qualifier</b>	<b>Type Description</b>	<b>Severity</b>	<b>Comments</b>
<b>Exterior:</b>			
Right Rear Qtr Panel Extension	Multiple Dents	1" to 1 1/2"	2 DENTS
Right Rear Qtr Panel Extension	Scratched	4" to 5"	LIGHT
Right Rear Qtr Panel Extension	Chipped	1/8" or less	RUSTED
Front Bumper	Previous Repair	Over 12"	OVERSPRAY, RUSTED BOLTS,MISSING BOLT
Front Bumper	Scratched	1 1/2" to 2"	RUST
Left Front Door	Dented, No Pnt Dmg	1" to 1 1/2"	
Left Front Door	Scratched	2" to 3"	LIGHT
Rear Bumper	Previous Repair	Over 12"	DIRT IN PAINT, OVERSPRAY
Right Rear Door	Multiple Dents	1" to 1 1/2"	3 DENTS
Right Front Door	Dented, No Pnt Dmg	1/2" to 1"	
Left Front Fender	Scratched	1" to 1 1/2"	LIGHT

**Interior:**

Rear Seat Cushion-Left	Worn	1" to 1 1/2"	IMPRESSIONS FROM CHILD SEAT
Rear Seat Cushion	Stained/Soiled	2" to 3"	2 STAINS
Front Seat Cushion-Left	Worn	4" to 5"	SOME WEAR ON SIDE

**Tires & Wheels:**

Right Front Tire	Other - See Notation	Other	PLUG IN THREAD, SEE PHOTO
Left Rear Wheel	Hardware Missing	Other	VALVE STEM CAP MISSING, METAL

**Glass:**

No Exceptions Recorded

**INSPECTION CHECKLIST:**

Smokers Flag: Yes

**TEST DRIVE:**

Test drive info. entered	Recommend brakes be checked further by a certified technician
Engine performs with no noticeable defects	Transmission performs with no noticeable defects
Instrument panel performs with no noticeable defects	Steering performs with no noticeable defects

**Inspection Comments:**

TIRE WEAR EVEN ON ALL TIRES, NO SIDEWALL SCUFFING ROADTEST COMPLETE, BRAKE PEDAL, SPONGY, WILL BOTTOM OUT, WHEELS HAVE NO CURB DAMAGE OR SCRATCHES












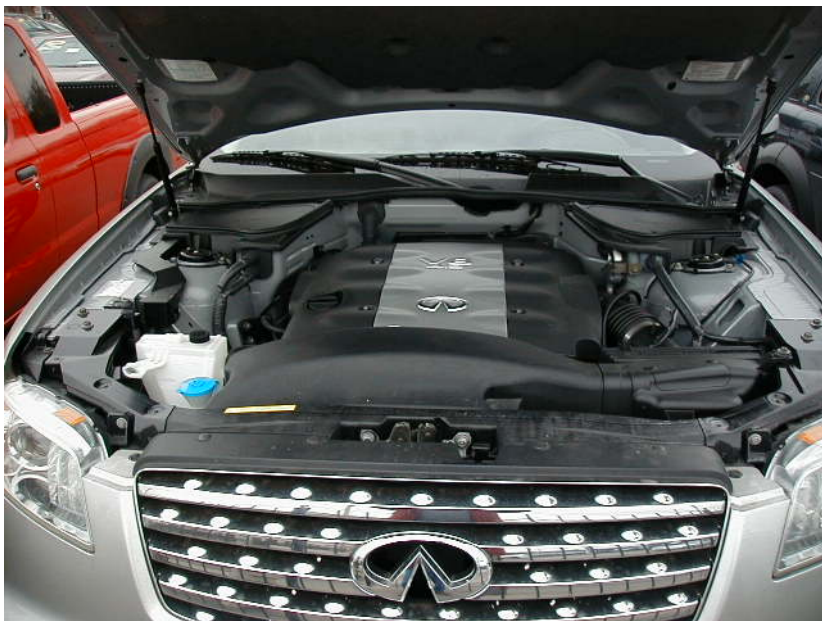





WITH P265/50R20 TIRES,  
20X8JJ RIMS, AT 32 PSI  
COLD SINGLE

THIS VEHICLE CONFORMS  
TO ALL APPLICABLE FED-  
ERAL MOTOR VEHICLE SA-  
FETY AND THEFT PREVEN-  
TION STANDARDS IN EFF-  
ECT ON THE DATE OF MA-  
NUFACTURE SHOWN ABOVE.

JNRBS08W53X402040  
MPV



VEHICLE CAPACITY WEIGHT	950 lbs	SEATING CAPACITY	FRONT AVANT	2	TOTAL TOTAL	SPARE TIRE ROUE DE SECOURS	kPa (psi)
POIDS UTILE DU VEHICULE	431 kg	NOMBRE DE PLACES	REAR ARRIERE	3	5	T175/90 D18 111M	420 (60)
RECOMMENDED COLD TIRE INFLATION PRESSURE PRESSION DE GONFLAGE RECOMMANDEE DES PNEUS FROIDS						DO NOT USE IN EXCESS OF 50MPH, 80km/h. SEE OWNER'S MANUAL FOR ADDITIONAL INFORMATION. UTILISATION A UNE VITESSE MAX 50mph, 80km/h. POUR LES DETAILS SE REFERER AU MANUEL DU CONDUCTEUR.	
TIRE SIZE DIMENSIONS	FRONT AVANT	kPa (psi)	REAR ARRIERE	kPa (psi)			
P265/50R20 106V	220 (32)		220 (32)				
P265/60R18 109V	220 (32)		220 (32)				

CG000

